

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Dickinson  
 (County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

1. Public Land Survey      T \_\_\_ R \_\_\_ \_\_\_\_\_  
                                   T \_\_\_ R \_\_\_ \_\_\_\_\_  
                                   T \_\_\_ R \_\_\_ \_\_\_\_\_  
                                   T \_\_\_ R \_\_\_ \_\_\_\_\_

2. Property Controlling      S 4 T 40NR 29W      10  
 in Section                    S 4 T 40NR 29W      8

3. Miscellaneous            S \_\_\_ T \_\_\_ R \_\_\_ \_\_\_\_\_  
 Property in Sec.            S \_\_\_ T \_\_\_ R \_\_\_ \_\_\_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Mar 14 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	10			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:  
 (10-Sec. 4) South 1/16 corner between Sections 4-5. Not established in the original survey.  
 (8-Sec. 4) West 1/16 corner, Section 4. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(10-Sec. 4) Established the corner midway and on a line of mean true bearing between Quarter and Section corners 1328.8' north and south.  
 (8-Sec. 4) Established the corner midway and on a straight line between Quarter corner and Center of Section 1316.6' west and east. From the position thus established, I found a 1.5" dia. iron pipe, not of record, N02W 73 ft. distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(10) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: 8" Maple S72E 25.6'      "1/16S BT" 4" Sugar S03W 25.6'      do 24" Cedar S70W 40.0'      do 9" Hemlock N09W 32.2'      do Sqd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(8) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: 15" Hemlock N55E 30.9'      "1/16S BT" 15" Hemlock S67E 26.7'      do 10" Sugar S34W 25.6'      do 12" Hemlock N66W 25.7'      do Sqd Cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
--	--

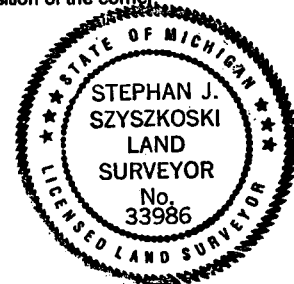

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 3/29/01

For the Michigan Department of Natural Resources - Forest Management Division