

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson
 (County)

Located In: _____ Corner Code # _____

1. Public Land Survey T 40N R 29W 62
 T R
 T R
 T R

2. Property Controlling S 4 T 40N R 29W 9
 in Section S T R
 3. Miscellaneous S T R
 Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

62 Nov 29 2000
 9 Mar 12 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5			4	●	3		2		1	
3												
4	7	8			9		10		11		12	
5												
6	10	17			16		15		14		13	
7												
8	19	20			21		22		23		24	
9												
10	30	29			28		27		26		25	
11												
12	31	32			33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (G2) Quarter corner common to Sections 3-4. Established in 1849 by James Mullett DS: North between Sections 3 & 4...36.00 To foot of hill 50 feet. 38.00 Begin to ascend. 40.00 Set quarter Sec. post Hemlock 12 S57W 21, Sugar 12 S12W 13. 41.00 Summit of hill 40 feet and descend...89.03 Intersected 4th Correction Line and set post.
 (9-Sec. 4) East 1/16 corner, Section 4. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G2) The original post and accessories were not recovered. The mile G3-G1 is approximately 4.1 chains longer than the record. The location of the topographic calls along this line suggest strongly that the error belongs in the north 1/2 mile, and that is where I placed it. I reestablished the corner at record distance north (40.00 chains) of monumented G3 and on a line of mean true bearing between G1 and G3. From the position thus established, the topographic calls noted above check very well with the record.
 (9-Sec. 4) Established the corner midway and on a straight line between Center of Section 1326.86' west and Quarter corner 1326.86' east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G2) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: 3" Maple S64E 39.7' "1/4S N8T" 4" Spruce S35W 13.6' do 10" Sugar N85W 24.7' do 12" Hemlock N67W 49.7' do Sqd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(9) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: 10" Sugar S49W 29.4' "1/16S 8T" 15" W. Pine S79E 23.4' do 10" Cedar S41E 54.4' do 8" Sugar S17W 50.5' do Sqd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
--	---

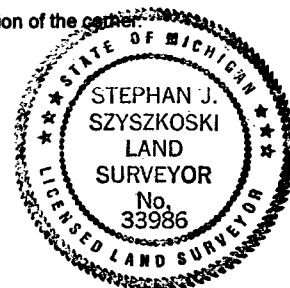

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/29/01

For the Michigan Department of Natural Resources - Forest Management Division