SURVEY &
REMONUMENTATION

FEB 13 2001

SECTION

# BRANCH COUNTY REMONUMENTATION
# LAND CORNER RECORDATION CERTIFICATE
**Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN
Branch County
Recorded

12-15-2000 14:07:12

Linda Lee Morrison-Mathews
REGISTER OF DEEDS

Liber 00004 Page 0125

**Register of Deeds Stamp & File Number**

For corners in

BRANCH
(County)

| | | Located In: | Corner Code # |
|---|---|---|---|
| UNION TOWNSHIP | | | |
| 1. Public Land Survey | | T 5S R 7W | A-11 |
| | | T___ R___ | |
| | | T___ R___ | |
| | | T___ R___ | |
| 2. Property Controlling | S___ | T___ R___ | |
| in Section | S___ | T___ R___ | |
| 3. Miscellaneous | S___ | T___ R___ | |
| Property in Sec. | S___ | T___ R___ | |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

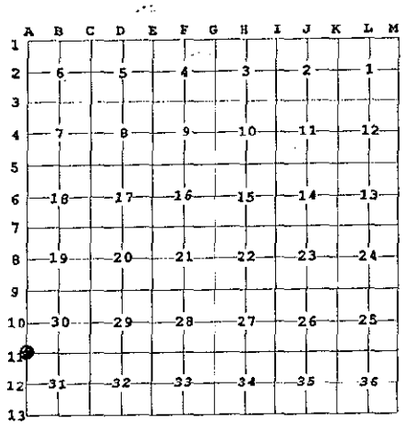


I, ROBERT R. CARR, in a field survey on NOVEMBER 17, 20 00 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

*NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.*

A. Description of original monument and accessories and/or subsequent restoration:

GLO: ROBERT CLARK JR., D.S. 1826
INTERSECTED WEST BOUNDARY 71 LINKS SOUTH OF POST
BEACH 12" N30 E, 43 LKS. SUGAR 11" S46E 34-1/2 LKS.
(REFERENCE) SURVEY IN SECTION 36, T5S, R8W, SHERWOOD TOWNSHIP,
BY C. HAMILTON, COUNTY SURVEYOR, JUNE 1881.

ACCEPTED BY THE BRANCH COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 11-28-2000

E. R. Reed, P.S.
E. R. REED, C. Rep.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

PREVIOUS MONUMENTATION AND BEARINGS ARE GONE.
REESTABLISHED CORNER AT GLO DISTANCE OF 71 LINKS (46.86 FEET)
SOUTH OF CORNER TO SECTIONS 25 AND 36, T5S, R8W AS
REESTABLISHED FROM OCCUPATION AND NOTES OF 1881 SURVEY IN
SECTION 36, T5S, R8W BY HAMILTON.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

STANDARD BRANCH COUNTY REMONUMENTATION 1/2" STEEL ROD AND CAP
STAMPED NO. 20704 IN MONUMENT BOX SET 6" BELOW DITCH BOTTOM
ON SOUTH SIDE OF FRANCISCO ROAD.
CENTER OF 5" STEEL FENCE POST, N5°W 52.2 FEET
CENTER OF 12" DIA. CONCRETE POST, SOUTH 9.6 FEET
UTILITY POLE, SOUTH 40.3 FEET (NAIL AND SPOTTER)
16" MAPLE, S04°W 25.2 FEET (NAIL AND SPOTTER)
36" MAPLE, S70°E 44.5 FEET (NAIL AND SPOTTER)
CORNER TO SECTIONS 25 & 36, T5S, R8W, NORTH 46.86 FEET

AND IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Robert R. Carr Date 11-28-2000

Surveyor's Michigan License No. 20704 ROBERT R. CARR

STATE OF MICHIGAN ROBERT R. CARR PROFESSIONAL SURVEYOR NO. 20704

COPY IS FOR DEPARTMENTAL MAP PURPOSES ONLY THIS COPY NOT TO BE REPRODUCED AND PUBLIC TO REGISTER OF DEEDS FOR COPIES.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995