

SURVEY & REMONUMENTATION

MAR 19 1997

COMMISSION 1996

Re-Man Liked 1, Page 64

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Bingham Township

<u>Huron County</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>15</u> N R <u>13</u> E	<u>K-13</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

STATE OF MICHIGAN
HURON COUNTY
RECORDED
7 NOV 96 4:10 P.M.
FRANCES L. HOLDWICK
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Russell L. Brown, in a field survey on Oct. 7, 1996, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 1834 G.L.O., H. Parke D.S. 1883 Duncan McFadden C.S.
 Set Post Corner Section 35 and 36 Survey of Section 36, T15N-R13E.
 Hemlock 11", N31 1/2°W 19 1/2 Links Found established Post
 Hemlock 6", N69°E 20 1/2 Links No witnesses stated

County Road Commission Records: County Surveyors Records:
 5/8" Steel Pin in center of grades NONE
 Corner fence post, N50°E 53.80' Act 74 Forms:
 NONE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 3/4" Steel Stake in centerline intersection gravel roads North, West and East, ...

Accepted: Found 3/4" Steel Stake as best evidence of original position of Corner K-13.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Corner Section 35 and 36, T15N-R13E K-13
 Found 3/4" Steel Stake
 WITNESSES:
 N45°W 54.10' to 1/2" Dia Steel Stake Capped RLS 24588
 S50°W 80.19' to Spike in Southeast Side of 10" Twin Thornapple Tree
 S60°E 35.33' to 1/2" Dia Steel Stake capped RLS 24588
 N45°E 58.32' to 1/2" Dia. Steel Stake capped RLS 24588

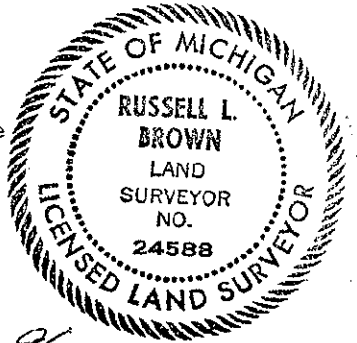

Signed by Russell L. Brown
 Surveyor's Michigan License No. 24588

Date 11-05-96

PEER GROUP APPROVED
 AT MEETING 11-05-96