

SURVEY & REMONUMENTATION

MAR 03 1998

KENT COUNTY REMONUMENTATION

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
KENT COUNTY

Located In:

Corner Code #

	T 6N	R 9W	H-6
1. Public Land Survey	T	R	
	T	R	
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORDING
97 OCT 14 AM 10:01
REG. OF DEEDS
Luci Standa

10042

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Kirk Breitels, in a field survey on July 2, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-6 1830---GLO---Not Set
1968---Kent Co. Wits.---3/4" Iron
11" Oak W 37.78' 25" Tw. Oak NNE 59.78'
37" Tri. Oak N 47.15' 14" Oak E 15.25'
1972---LCRC #158---Bonnema---Iron
12" Oak WNW 37.30' 12" Oak SSE 11.21' 16" Oak NE 10.69'
1976---Williams & Works---Fd. & accepted Iron per recorded witnesses

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- H-6 Found 3/4" Iron Pipe per the following witnesses:
Fd. Nail in 22" Oak SSE 11.19'
Fd. Nail in 27" Oak ENE 10.98'
Fd. Nail in 18" Oak WNW 37.47'

The 3/4" Iron Pipe is 0.5' S. and 1.0' E. of intersection of 1/4 lines and agrees with measurements of others.

The 3/4" Iron Pipe is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- H-6 Set Standard Kent Co. Monument (Harrison) in place of the 3/4" Iron Pipe
Nail & KC Remon. tag W. side 22" Oak S20°E 11.19'
Nail & KC Remon. tag N. side 18" Oak N70°W 37.47'
Nail & KC Remon. tag S. side 27" Oak N65°E 10.98'
Nail & KC Remon. tag E. side 10" Oak N20°W 31.36'
Capped Rerod (Exxel) - North 65.36'

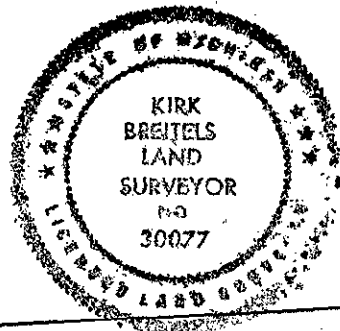

Signed by *Kirk Breitels*
Surveyor's Michigan License No. 30077

Date 8/28/97

P.A. 345 1990 KENT COUNTY

PEER APPROVED 7/24/97
CHAIRMAN *Harry Ruben*