

**SURVEY &
REMONUMENTATION**

SEP 1 1 2007

SECTION



OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE*
Filing Requirement of Act 74, Mich. P.A. 1970

L C 8 - 1 6 2 *

For corners in
OSCODA
(County)

Located In: Corner Code #

OSCODA COUNTY

REGISTER OF DEEDS

08/29/2007 10:09:00AM

FEE: \$17.00

PAGES: 2 RCPT#: 5761

LC8-116 CORNER RECORDATION

T26N R1E H-3

APPROVED

- Public Land Survey
- Property Controlling S
- Miscellaneous S
- Property in Sec. S

R County Remonumentation

Peer Review Group

4. Lot No. Recorded Plat

Private

5. *ACC 25 AUG 07* Claims

Register of Deeds Stamp & File Number

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 1 | | | | | | | | | | | | | |
| 2 | 6 | 5 | 4 | 3 | 2 | | | | | | | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |
| 13 | | | | | | | | | | | | | |

I, Maxin E. Myers, P.S., in a field survey on April 23, 2007, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management, or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

H-3 Quarter Section Corner common to Sections 3 & 10 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set quarter Section post

Wit: Spr Pine 4" N05°E 10 lks (6.60)

Spr Pine 4" S12°E 10 lks (6.60)

1887 Oscoda County Surveyor John Randall

Mon.- Identified quarter Section post bet Secs 3 by the following U S bearing trees, both lying down with roots in ground and both legible;

Wit: Spr Pine 4" N05°E 10 lks (6.60)

Spr Pine 4" S12°E 10 lks (6.60)

Marked following for new bearing tree;

Y Pine 10" N46°W 2.08 chs (137.28)

Part A continued on back:

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-3 Quarter Section Corner common to Sections 3 & 10 of T.26N.-R.1E.


Found USGLO concrete monument with brass cap; found 2" pipe bent and broke North 23.1±; found 10" R pine S10°W 28.21; found 9" J Pine N70°W 11.15; found Carsonite post East 1±; found 10" Oak N10°E 15.75. Accepted the found concrete monument as a careful and faithful re-establishment of the position of the original government corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-3 Quarter Section Corner common to Sections 3 & 10 of T.26N.-R.1E.

Mon - USGLO concrete monument with brass cap.

- Wit:
- North 23.1± 2" pipe bent and broke
 - S10°W 28.21' 10" R Pine
 - N70°W 11.15' 9" J Pine
 - East 1± Carsonite post
 - N10°E 15.75' 10" Oak
 - SW 1.5± 4" Cedar Post
 - S43°E 23.06' 12" R Pine

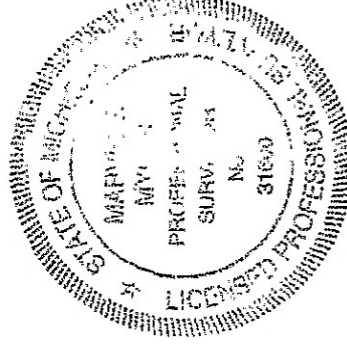

Signed by Maxin E. Myers
Surveyor's Michigan License No. 31600

Date August 22, 2007