

40N 29W H1
 70N 29W I1

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1999 NOV 30 PM 3:31

For corners in

DICKINSON Located In: _____ Corner Code # _____
 (County)
 NORWAY TOWNSHIP

1. Public Land Survey T 41 N R 29 W H-13
 T 41 N R 29 W I-13
 T _____ R _____
 T _____ R _____ SURVEY &
 2. Property Controlling S _____ T _____ R _____ REMONUMENTATION
 in Section S _____ T _____ R _____
 3. Miscellaneous S _____ T _____ R _____ MAR 24 2000
 Property in Sec. S _____ T _____ R _____

REGISTER OF DEEDS
 DICKINSON COUNTY
 RON MOORE, CLERK

Register of Deeds Stamp & File Number

SECTION

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, JAMES H. MOORE, in a field survey on SEPTEMBER 9 & OCTOBER 13, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

H-13 SOUTH 1/4 CORNER OF SECTION 34 FOUND 10" CEDAR PER AUSTIN BURT, D.S. 1846
 USED 10" CEDAR AS CORNER NO WITNESSES SET

I-13 CORNER COMMON TO SECTIONS 34-35, T41N-R29W CEDAR POST BY AUSTIN BURT, D.S. 1846
 HEMLOCK 14" N 41° E 30 LINKS
 HEMLOCK 14" N 48° W 22 LINKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-13 FOUND 1" PIPE WITH 4" MICHIGAN DEPARTMENT OF CONSERVATION BRASS CAP, SET BY DEAN DE LA MATER R.L.S. # 13030 FOUND 2 EXISTING CEDAR B.T.'S IN POOR CONDITION.
 1954 BEARING TREES
 14" CEDAR S 48° W 25 LINKS
 12" CEDAR S 40° E 29 LINKS

I-13 FOUND 1" PIPE WITH 4" MICHIGAN DEPARTMENT OF CONSERVATION BRASS CAP, SET BY DEAN DE LA MATER R.L.S. # 13030.
 NO WITNESSES SET IN 1954.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-13 FOUND ABOVE DESCRIBED MONUMENT IN PLACE. NEW WITNESSES.
 8" WHITE BIRCH NORTH (M.B.) 32.60' NAIL/TAG
 5" HARD MAPLE S 73° E (M.B.) 49.55' NAIL/TAG
 12" CEDAR S 19° E (M.B.) 45.49' NAIL/TAG
 12" BLACK SPRUCE S 75° W (M.B.) 25.63' NAIL/TAG
 CARSONITE MARKER WEST 0.90'

I-13 FOUND ABOVE DESCRIBED MONUMENT IN PLACE. NEW WITNESSES.
 8" SPRUCE N 08° E (M.B.) 22.60' NAIL/TAG
 3" BALSAM S 13° E (M.B.) 12.50' NAIL/TAG
 6" BALSAM S 30° E (M.B.) 12.40' NAIL/TAG
 2" CHERRY S 55° W (M.B.) 8.15' NAIL/TAG
 CARSONITE MARKER S 65° E 1.15'

Signed by JAMES H. MOORE
 Surveyor's Michigan License No. P.S. 28423

Date 11-8-99

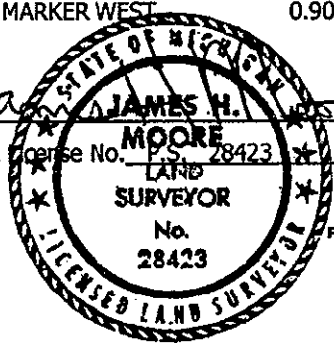

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975

ADOPTED BY THE DICKINSON COUNTY SURVEYOR PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON

REVISED JAN., 1983
 REVISED OCT., 1995

11-23-99
Ron Moore
 COUNTY REPRESENTATIVE