

**SURVEY & REMONUMENTATION**

FEB 14 1997

**KENT COUNTY REMONUMENTATION**

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
**KENT COUNTY**  
(County)

Located In:	Corner Code #
T6N R10W	J-12
T R	
T R	
T R	
S T R	
S T R	
S T R	
S T R	

- 1. Public Land Survey
- 2. Property Controlling in Section
- 3. Miscellaneous Property in Sec.

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Kirk Breitels, in a field survey on Aug. 15, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

STATE OF MICHIGAN  
COUNTY OF KENT  
RECEIVED FOR RECORD  
96 SEP 13 PM 12:06  
REG. OF DEEDS  
*Lucy Hand*  
**9377**  
Register of Deeds Stamp & File Number

A. Description of original monument and accessories and/or subsequent restoration:

- J-12 1831---GLO---Not Set 1932-56---W & W---Center per fences, school lot, C/L road
- 1963-64---Williams & Works---Mon. Box
- Kent Co. Wit.---Mon. Box: 2" Gate Post NNW 64.30'
- SW chor. cor. NE 63.12' 38" Hick. E 48.68' 2" Gate Post SSW 78.91'
- 1972---LCRC #113---Spicer---3/4" Iron in Mon. Box
- SW cor. chr. N55°E 63.08' 40" Maple S82°E 48.68' NW cor. chr. N30°E 81.39'
- 1980---Survey---Nederveld & Jonker---Round Iron in Mon. Box
- 1988---Survey---Exxel Eng.---3/4" Iron in Mon. Box
- 1993---Survey---Tru-Line---3/4" Iron in Mon. Box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- J-12 Found 3/4" Iron Pipe in Mon. Box per the following witnesses:
- SW cor. church fnd. N55°E 63.05'
- NW cor. church fnd. N30°E 81.36'
- On C/L N-S Asph. Rd.


P.A. 345 1990 KENT COUNTY  
PEER APPROVED 7/25/96  
CHAIRMAN *Harry Huber*

Said 3/4" Iron Pipe in Mon. Box is 0.1' W and 1.1' S. from intersection of 1/4 lines and agrees with measurements of others.

The 3/4" Iron Pipe in Mon. Box is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J-12 Set Standard Kent County Monument inside a Mon. Box place of the 3/4" Iron Pipe
- SW corner church foundation N55°E 63.05'
- NW corner church foundation N30°E 81.36'
- NE corner top of "Clark" tombstone S60°W 54.88'
- W. face of steel post S85°E 30.34'
- Set Nail & KC Remon. tag E. side 14" Cherry N20°W 82.10'
- On C/L Whitneyville Rd. N-S

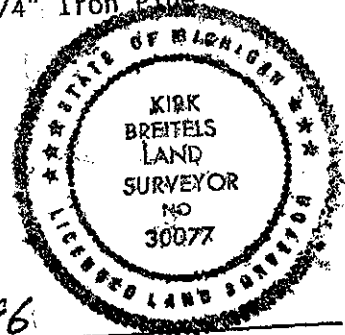

Signed by *Kirk Breitels*  
Surveyor's Michigan License No. 30077

Date 8/25/96