

SURVEY & REMONUMENTATION

OTTAWA COUNTY REMONUMENTATION

APR 05 1996

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in
OTTAWA
(County)

Located In: Corner Code #

- | | | | |
|------------------------------------|------|-------|---|
| 1. Public Land Survey | T 6N | R 13W | I-13 (SE corner Section 34) Georgetown Twp. |
| | T | R | |
| | T | R | |
| | T | R | |
| 2. Property Controlling in Section | S | T | R |
| | S | T | R |
| 3. Miscellaneous Property in Sec. | S | T | R |
| | S | T | R |

RECORDED
95 NOV 15 PM 2:10

Polythia Chubb
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Randal J. Vugteveen, in a field survey on October 19, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
I-13 Common corner to Sections 34 & 35

1831 - Sibley	Liber 2, page 529
Set post	"T" iron
Sugar N45 W13 16 Links	PK in side pp NNW 51.86'
Beech N54 E7 8 Links	Nail in side 8" Ash NW 48.33'
	3/4" iron E 16.48' on tree line to N

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
I-13 Found "T" iron 7' North of centerline gravel Jackson St. and accepted as a careful and faithful perpetuation of the position of the original corner


"T" Iron / PK in side p. pole NNW 51.86' /
Found Nail & B.C. SW side dead 10" Ash AZ
308 deg NW 48.34' / 3/4" iron E 16.44' on
tree line to N

RA. 345 OTTAWA COUNTY
PEER APPROVED 10/23/95

MDY
Medoy P. Nedewell

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
I-13 Removed "T" iron, set 3/4" X 36" solid bar with Ottawa County Remon Cap 6" below gravel road

Found MVK capped iron Az. 0 deg 32.94'
Found 3/4" iron pipe (Jamestown corner) Az. 90 deg 16.44'
Found N & J capped iron Az. 155 deg 36.67'
Set Ottawa County Remon Nail & Tag E side p. pole Az. 347 deg 51.80'
Set chisled "X" in NE corner conc driveway Az. 234 deg 59.96'
Set Ottawa County Remon Nail & Tag in S side 10" Ash Az. 64 deg 41.98'

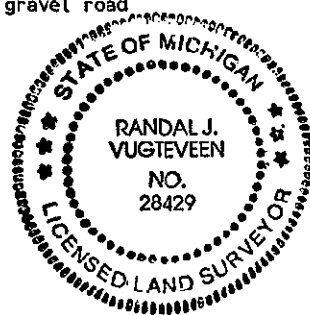

Signed by *Randal J. Vugteveen*
Surveyor's Michigan License No. 28429

Date Oct. 20, 1995