

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Table with columns: ONTONAGON (County), Located In:, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

SURVEY & REMONUMENTATION

MAR 23 2000

SECTION


Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

1/4 Corner common to Sections 28 & 29, T49N R42W.

I, Earl W. Applekamp, in a field survey on April 13, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

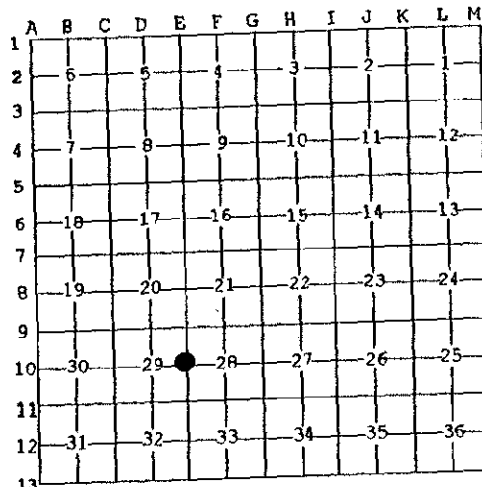

A. Description of original monument and accessories and/or subsequent restoration:

Original Corner established by William Burt, U.S. Deputy Surveyor, June 13, 1848. Set Sugar Post.

ORIGINAL BEARING TREES:

Table with 3 columns: Tree type, Bearing, Distance. Includes 18" Hemlock (S75°E, 17.16 feet) and 14" Sugar (N70°W, 13.20 feet).

Handwritten signature of Earl W. Applekamp, dated 5-11-99, with 'PEER GROUP APPROVED' and 'COUNTY REPRESENTATIVE' stamps.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. A 1/2" iron pin was found at the site which was on line and equal distance between opposite section corners North & South. The 1/2" iron pin was in a dirt road and was used for a previous survey. The corner is 66.6' feet East of the center-line of Highway M-64.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I replaced the 1/2" iron pin with a 5/8"X12" rebar with a 3" stamped cap 5" below the top of a dirt road. I established a reference monument, a 2 1/2"X30" split base aluminum pipe with a 3" cap stamped to read: County Remonumentation, T49N R42W, S28, S29, 1/4, R.M., 1999, P.S. 17610. I established three other bearing objects.

Table with 5 columns: Object, Bearing, Distance, Bearing, Distance. Includes Nail in 12" H. Maple (N67°W, 152.22' - REF.MON., S57°E, 22.32'), Nail in P. Pole (N15°E, 154.53'), and Nail in P. Pole (S19°E, 171.71').

Signed by Earl W. Applekamp
Surveyor's Michigan License No. 17610

Date May 3, 1999

